

## SERVICE BULLETIN



Number 20170607

ABN: 55 051 202 067

Date 07/06/2017

**Head Office**

Unit 1/35 Rimfire Drive

Hallam, VIC 3803

Phone: 03 8786 3570

Fax: 07 5462 8396

[sales@austwiderentals.com](mailto:sales@austwiderentals.com)

**Title:** LASSELE ERROR CODES.

**Models effected:** LASSELE PRODUCTS FITTED WITH PROPIETRY CONTROLLER

**Reason:** ERROR CODES HELP WITH PROBLEM SOLVING.

The following error code will appear on the display panel when errors are detected.

| Error code | Code             | Error explanation  |
|------------|------------------|--|
| "S1 "      | Sensor Cabi temp | Disconnected Sensor or Cabi temp is under-58°F                     |
| "S1_ "     | Sensor Cabi temp | Shortage of Sensor or Cabi temp is under 149°F                     |
| "rt "      | Ambient sensor   | Disconnected Sensor  |
| "rt_ "     | Ambient sensor   | Shortage of Sensor   |
| "D1 "      | Defrost Sensor   | Disconnected Sensor or Cabi temp is under-58°F                     |
| "D1_ "     | Defrost Sensor   | Shortage of Sensor or Cabi temp is under 149°F                     |
| "dF1"      | Fail to defrost  | if perform the defrost over 50 min                                 |
| "CF1"      | Cooling Cycle    | After pass 30 min from start working , Defrost sensor reached 32°F |
| "EHF"      | Hi temp Frz      | if cabinet temp is keeping 59°F for 8 hr                           |
| "EHr"      | Hi temp Ref      | if cabinet temp is keeping 45°F for 3 hr                           |
| "Edr"      | Open Door        | if Door S/W is open for 1 Hr                                       |
| "UFn"      | Vapor Pan        | Vapor pan is not connected   |